Joining Data Sheet XVT-2226



Product Code:	XVT-2226 Click here to open Product Data Sheet
Product Group:	Polyamide folder-gluer belts
Joining System:	Flexproof


Important

- Joining is also possible with other Habasit devices.
- Machine setting data should be derived from the relevant operating instructions.
- Read the operating instructions of the necessary tools carefully before making the first joint.
- All data are approximate values and defined under the following standard climatic conditions:
 > 23 °C/73 °F, 50 % relative humidity (DIN 50005/ISO 554), working voltage 225 235 V / 105 115 V.
- > Any change of these data may require different temperature and/or time and/or pressure.
- For further support, please contact the Habasit company responsible for your location.

Finger Cutting

Finger Cutting Device:	AF-100 / AF-100US	
Dimensione		

Dimensions

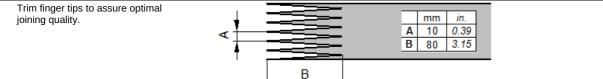

Hot Pressing PF-61 / PF-62

Hot Pressing Device:	PF-61 / PF-62

Settings

Belt/Tape Width Range:	0-35 mm 0-1.4 inch	35-50 mm 1.4-2 inch	50-60 mm 2-2.4 inch	
Pressing Temperature, Top:	180 °C 355 °F	180 °C 355 °F	180 °C 355 °F	
Pressing Temperature, Bottom:	180 °C 355 °F	180 °C 355 °F	180 °C 355 °F	
Pressing Time:	10 min	12 min	12 min	
Cooling Time:	10 min	12 min	12 min	

Inserts

	Тор		
6		Heating plate; top	
5		Covering plate (offset for easier removal)	
4		Teflon	
3	•	Belt (conveying side up)	
2		Guide rail (exactly centered in press)	
1	555	Heating plate; bottom	
	Bottom		
Pressing Remarks:		REMARK: 0-35 mm / 1.4 in. belt width: use guide rails with narrow base plate. REMARK: 35-50 mm / 1.4-2.0 in. belt width: use guide rails with wide base plate. REMARK: 50-60 mm / 2.0-2.4 in. belt width: use guide rails with wide base plate. REMARK: If cover plate sticks to the belt: cut a strip of Teflon exactly the width of the belt (using the cover plate as a template) and place it on the belt.	

Product Liability

If the proper selection and application of Habasit products are not recommended by an authorized Habasit sales specialist, the selection and application of Habasit products, including the related area of product safety, are the responsibility of the customer.

All indications / information are recommendations and believed to be reliable, but no representations, guarantees, or warranties of any kind are made as to their accuracy or suitability for particular applications. The data provided herein are based on laboratory work with small-scale test equipment, running at standard conditions, and do not necessarily match product performance in industrial use. New knowledge and experiences can lead to modifications and changes within a short time without prior notice.

BECAUSE CONDITIONS OF USE ARE OUTSIDE OF HABASIT'S AND ITS AFFILIATED COMPANIES CONTROL, WE CANNOT ASSUME ANY LIABILITY CONCERNING THE SUITABILITY AND PROCESS ABILITY OF THE PRODUCTS MENTIONED HEREIN. THIS ALSO APPLIES TO PROCESS RESULTS / OUTPUT / MANUFACTURING GOODS AS WELL AS TO POSSIBLE DEFECTS, DAMAGES, CONSEQUENTIAL DAMAGES, AND FURTHER-REACHING CONSEQUENCES.

Last modification on 10/25/2018